



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 039/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510059
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932347               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |
| 2. 932350               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

### THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027



For and on behalf of



**FERIYANSYAH**

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 039/MJAP/III/26

GENERAL PARTICULARS			
<b>Name Of Ship</b> : CB. PAN MARINE 2 <b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA <b>IMO-No</b> : 8985452 <b>Class</b> : -	<b>Nationality/Port of Registry</b> : INDONESIA <b>Call Sign</b> : YD4299 <b>MMSI No</b> : 525016104 <b>Date of Service</b> : 13 MARET 2026		
<b>Kind Of Service</b> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> Annual</div> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> 5 Yearly</div> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> Repair</div> </div>			

REMARKS :

*" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "*

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridie / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>• EMERGENCY PACK •</b>	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	11/2030

**" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "**

\*\* Working Code : ( RP = Repair ) , ( RN = Renewed ) , ( OK = Good ) , ( EXP = Expired ) , ( SP = Supply ) , ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

Certificate No.: 039/MJAP/III/26

RAFT AND CYLINDER TEST									
PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
	Cylinder No.1		932347		-	-	2,600	0,180	16,4
	Cylinder No.2		932350		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks	DATE				
Load Test Date:	-	WP-TEST		YES	13/03/2026				
Suspension Straps/Patches	-	FS-TEST		-	-				
Shackle	-	NAP-TEST		-	-				
Steering Line With Patches	-	GL-TEST		-	-				
Bowsing Line With Patches	-	RAFT		Serial No.	AR 2510059		Man of date : 10 - 2011		
Container Line Incl. Pocket	-			Type	FF - QF - A 25		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	GUANG ZHOU FENGFAN				
"RAFT IN GOOD CONDOTION"									

### Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,

An. KEPALA KANTOR KSOP UTAMA TANJUNG PRIUK  
KABUPATEN KEPALAN DAN KEPELAUTAN

Surveyor	: AGUS FERIYANSYAH
Next Inspection Date	: 12 MARET 2027

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 038/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510058
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932337               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |
| 2. 932340               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

### THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027



For and on behalf of



**FERIANSYAH**

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 038/MJAP/III/26

GENERAL PARTICULARS			
<b>Name Of Ship</b> : CB. PAN MARINE 2 <b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA <b>IMO-No</b> : 8985452 <b>Class</b> : -	<b>Nationality/Port of Registry</b> : INDONESIA <b>Call Sign</b> : YD4299 <b>MMSI No</b> : 525016104 <b>Date of Service</b> : 13 MARET 2026		
<b>Kind Of Service</b> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> Annual</div> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> 5 Yearly</div> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/> Repair</div> </div>			

**REMARKS :**

*" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "*

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Becketts	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridie / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>* EMERGENCY PACK *</b>	
Outher Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pes
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pes
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pes
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pes
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pes
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pes
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pes
Launch And Raft		Repair Kit	OK	Expired Date	11/2030

**" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "**

\*\* Working Code : ( RP = Repair ), ( RN = Renewed ), ( OK = Good ), ( EXP = Expired ), ( SP = Supply ), ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 038/MJAP/III/26

## RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Preasure	Safety Valves	
	Time	Temp (°C)	Preasure (mmHg)	Time	Temp (°C)	Preasure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
Cylinder No.1	932337		-		-	-	2,600	0,180	16,4
Cylinder No.2	932340		-		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)	Remarks	DATE					
Load Test Date:	-	WP-TEST	YES	13/03/2026					
Suspension Straps/Patches	-	FS-TEST	-	-					
Shackle	-	NAP-TEST	-	-					
Steering Line With Patches	-	GL-TEST	-	-					
Bowsing Line With Patches	-	RAFT	Serial No.	AR 2510058		Man of date : 10 - 2011			
Container Line Incl. Pocket	-		Type	FF - QF - A 25		Capacity : 25 Persons			
Pocket for Steering/Bowsing Lines	-		Merk	GUANG ZHOU FENGFAN					
<b>"RAFT IN GOOD CONDOTION"</b>									

### Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,

KEPALA KANTOR KSOP UTAMA TANJUNG PRIUK  
KABID PELAYANAN DAN KEPSELAUTAN

HEMILANDRA, S.T.M.MTR  
Pembina (IV/a)  
NIP. 197901362007121001

Surveyor	: AGUS FERIYANSYAH
Next Inspection Date	: 12 MARET 2027

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 037/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510057
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932342               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |
| 2. 932344               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027



For and on behalf of



**FERIYANSYAH**

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 037/MJAP/III/26

### GENERAL PARTICULARS

<b>Name Of Ship</b> : CB. PAN MARINE 2	<b>Nationality/Port of Registry</b> : INDONESIA
<b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA	<b>Call Sign</b> : YD4299
<b>IMO-No</b> : 8985452	<b>MMSI No</b> : 525016104
<b>Class</b> : -	<b>Date of Service</b> : 13 MARET 2026
<b>Kind Of Service</b>	
<input checked="" type="checkbox"/> Annual	<input checked="" type="checkbox"/> 5 Yearly
	<input checked="" type="checkbox"/> Repair

### REMARKS :

" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strarpping	RN	Thwart,Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies,Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridie / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>* EMERGENCY PACK *</b>	
Outher Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	11/2030

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

\*\* Working Code : ( RP = Repair ), ( RN = Renewed ), ( OK = Good ), ( EXP = Expired ), ( SP = Supply ), ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 037/MJAP/III/26


RAFT AND CYLINDER TEST									
PREASURE TEST	Start			Finish			Preasure	Safety Valves	
	Time	Temp (°C)	Preasure (mmHg)	Time	Temp (°C)	Preasure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
Cylinder No.1	932342		-		-	-	2,600	0,180	16,4
Cylinder No.2	932344		-		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks	DATE				
Load Test Date:	-	WP-TEST		YES	13/03/2026				
Suspension Straps/Patches	-	FS-TEST		-	-				
Shackle	-	NAP-TEST		-	-				
Steering Line With Patches	-	GI-TEST		-	-				
Bowsing Line With Patches	-	RAFT		Serial No.	AR 2510057		Man of date : 10 - 2011		
Container Line Incl. Pocket	-			Type	FF - QF - A 25		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	GUANG ZHOU FENGFAN				
"RAFT IN GOOD CONDOTION"									

## Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

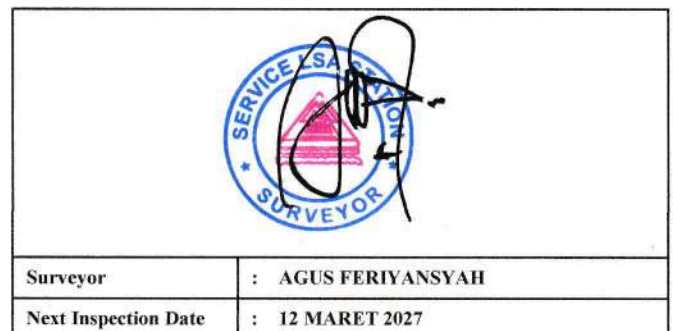

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 036/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510053
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932331               | 2,600 Kg                   | 0,180 Kg                  |          |
| 2. 932335               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027



For and on behalf of



**FERIYANSYAH**

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 036/MJAP/III/26

GENERAL PARTICULARS			
<b>Name Of Ship</b> : CB. PAN MARINE 2 <b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA <b>IMO-No</b> : 8985452 <b>Class</b> : -	<b>Nationality/Port of Registry</b> : INDONESIA <b>Call Sign</b> : YD4299 <b>MMSI No</b> : 525016104 <b>Date of Service</b> : 13 MARET 2026		
<b>Kind Of Service</b> <input checked="" type="checkbox"/> Annual <input checked="" type="checkbox"/> 5 Yearly <input checked="" type="checkbox"/> Repair			

**REMARKS :**

*" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "*

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
CONTAINER SHELL		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridie / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>• EMERGENCY PACK •</b>	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	11/2030

**" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "**

\*\* Working Code : ( RP = Repair ), ( RN = Renewed ), ( OK = Good ), ( EXP = Expired ), ( SP = Supply ), ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 036/MJAP/III/26

## RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
Cylinder No.1	932331		-		-	-	2,600	0,180	16,4
Cylinder No.2	932335		-		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks	DATE				
Load Test Date:	-	WP-TEST		YES	13/03/2026				
Suspension Straps/Patches	-	FS-TEST		-	-				
Shackle	-	NAP-TEST		-	-				
Steering Line With Patches	-	GI-TEST		-	-				
Bowsing Line With Patches	-	RAFT		Serial No.	AR 2510053		Man of date : 10 - 2011		
Container Line Incl. Pocket	-			Type	FF - QF - A 25		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	GUANG ZHOU FENGFAN				

"RAFT IN GOOD CONDOTION"

### Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,

KEMENTERIAN PERKAPALAN DAN KEPSELATAN  
KABID PERKAPALAN DAN KEPSELATAN  
HELI MI CANDRA, ST, SKMTR  
Rembina (IV/a)  
NIP. 197901162007121001

SURVEYOR

Surveyor	: AGUS FERİYANSYAH
Next Inspection Date	: 12 MARET 2027

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 035/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510052
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932329               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |
| 2. 932326               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027

For and on behalf of



**FERIYANSYAH**

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA





# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 035/MJAP/III/26

GENERAL PARTICULARS			
<b>Name Of Ship</b> : CB. PAN MARINE 2 <b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA <b>IMO-No</b> : 8985452 <b>Class</b> : -	<b>Nationality/Port of Registry</b> : INDONESIA <b>Call Sign</b> : YD4299 <b>MMSI No</b> : 525016104 <b>Date of Service</b> : 13 MARET 2026		
<b>Kind Of Service</b> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/></div> Annual           <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/></div> 5 Yearly           <div style="border: 1px solid black; padding: 2px;"><input checked="" type="checkbox"/></div> Repair         </div>			

**REMARKS :**

*" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "*

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
<b>CONTAINER SHELL</b>		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beackets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strapping	RN	Thwart, Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies, Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridie / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>• EMERGENCY PACK •</b>	
Outer Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	11/2030

**" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "**

\*\* Working Code : ( RP = Repair ) , ( RN = Renewed ) , ( OK = Good ) , ( EXP = Expired ) , ( SP = Supply ) , ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@gmail.com

Certificate No.: 035/MJAP/III/26

## RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Pressure	Safety Valves	
	Time	Temp (°C)	Pressure (mmHg)	Time	Temp (°C)	Pressure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
Cylinder No.1	932329		-		-	-	2,600	0,180	16,4
Cylinder No.2	932326		-		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks	DATE				
Load Test Date:	-	WP-TEST		YES	13/03/2026				
Suspension Straps/Patches	-	FS-TEST		-	-				
Shackle	-	NAP-TEST		-	-				
Steering Line With Patches	-	GI-TEST		-	-				
Bowsing Line With Patches	-	RAFT		Serial No.	AR 2510052		Man of date : 10 - 2011		
Container Line Incl. Pocket	-			Type	FF - QF - A 25		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	GUANG ZHOU FENGFAN				

"RAFT IN GOOD CONDOTION"

### Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,  
Kepala Kantor KSOP UTAMA TANJUNG PRIOK  
KABID PERKAPALAN DAN KEPELAUTAN

HEMI CANDRA, ST, M.MTr  
Pembina (W/a)  
NIP. 197901162007121001

Surveyor : AGUS FERİYANSYAH  
Next Inspection Date : 12 MARET 2027

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@ymail.com

## *Certificate Inflatable Liferaft*

Cert.No : 034/MJAP/ILR/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA
  - Name Of Ship : CB. PAN MARINE 2
  - Manufacturer : GUANG ZHOU FENGFAN
  - Carrying Capacity : 25 Persons
  - Liferaft Type : FF - QF - A 25
  - Date Of Manufacture : 10 - 2011
  - Serial No. : AR 2510051
  - Emergency Pack Type : SOLAS A PACK
- | CO <sup>2</sup> Cyl No. | Containing CO <sup>2</sup> | Containing N <sup>2</sup> | Total Wt |
|-------------------------|----------------------------|---------------------------|----------|
| 1. 932325               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |
| 2. 932321               | 2,600 Kg                   | 0,180 Kg                  | 16,4 Kg  |

THIS IS TO CERTIFY that

1. The above - mentoined inflatable liferaft has been inspected, repaired and tested and found to be in compliance with the under - mentioned requirements, the liferaft in serviceable condition. INTERNATIONAL CONVENTION FOR THE SAFETY OL LIFE AT SEA ( SOLAS ) and INTERNATIONAL LIFE - SAVING APPLIANCE ( LSA ) CODE
2. The technical condition of the equipment and appliances has been found to satisfaction, and the tested data report attached.
3. The technical condition of the above - mentioned inflatable liferaft has been found to satisfaction, end the log card has been endorsed accordingly.

- Date Of Issue : 13 Maret 2026
- Date Of next inspection : 12 Maret 2027

AN. KEPALA KANTOR KSOP UTAMA TANJUNG PRIOK

KANTOR PERKAPALAN DAN KEPELAUTAN



For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector  
At PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

**GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER**

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## LIFERAFT SERVICE REPORT

In Accordance to IMO Resolution MSC.388(94) Amandment to Resolution A.761(18)

Certificate No.: 034/MJAP/III/26

### GENERAL PARTICULARS

<b>Name Of Ship</b> : CB. PAN MARINE 2	<b>Nationality/Port of Registry</b> : INDONESIA
<b>Owner</b> : PT. PAN MARITIME WIRA PAWITRA	<b>Call Sign</b> : YD4299
<b>IMO-No</b> : 8985452	<b>MMSI No</b> : 525016104
<b>Class</b> : -	<b>Date of Service</b> : 13 MARET 2026
<b>Kind Of Service</b>	
<input checked="" type="checkbox"/> Annual	<input checked="" type="checkbox"/> 5 Yearly
	<input checked="" type="checkbox"/> Repair

### REMARKS :

" Food Ration, Drinking Water, Anti Seasickness, Painting & Marking Label "

DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK	DESCRIPTION ITEM	CHECK
<b>CONTAINER SHELL</b>		Installation Valve, Hose	OK	Leak Stoppers	OK
Label/Markings	RN	"T/Y" Place Connector	OK	Sponges	OK
Handling Beckets	OK	Protection Pads	OK	Bailers	OK
Gasket/Strap Packing List	OK	CO2 Cylinder (s)	OK	Spare Sea Anchor	OK
Painter Line	OK	Operating Cable & Condukt	OK	Torch, Signaling	OK
ID Container	RN	Operating Head	OK	Spare Batteries	OK
Valise Fabric/Plastic	RN	<b>SURVEY OF INTERIOR</b>		Whistle	OK
Eyelets	OK	Buoyancies Fabric	OK	Fishing Kit	OK
Painter Line Pockets	OK	Safety Relief Valves	NA	Can Openers	OK
Bursting Band	RN	Grabline & Patches/Loops	OK	Paddles	OK
Strarpping	RN	Thwart,Fabric	NA	Spare Bulb For Torch	OK
<b>SURVEY OF EXTERIOR</b>		Deflation Plugs/Valves	OK	Drinking Vessel	OK
Buoyancies,Fabric	OK	Arches, Fabric	OK	Seasickness Bag	OK
Inlet Valves	OK	Center Column Fabric	NA	Signal Mirror	OK
Deflation Plugs/Valves	OK	Light Battery	OK	Manual Survival Book	OK
Safety Relief Valve	OK	Interior Lighting System	OK	Rescue Signal Table	OK
Boarding Ramp	OK	Topping Up Valves	OK	Thermal Protective Aids	OK
Boarding Ladders	OK	Inner Canopy, Fabric	OK	Radar Reflector	OK
Towing Bridic / Patch	OK	Rainwater Catchment	OK	Dye Marker	NA
Lifeline and Patches	OK	Blowing Port (S)	RN	<b>EMERGENCY PACK</b>	
Outher Canopy Fabric	OK	Aerial Sleeve	OK	Food Ration	25 Pcs
Retro Reflective Tape	OK	Inner Floor, Fabric	OK	Expired Date	03/2029 RN
Seam and Taping	OK	Topping Up Valves	NA	Drinking Watter	75 Pcs
Rain Water Catchment	OK	Deflation Up Valves	NA	Expired Date	03/2029 RN
Exterior Linghting System	OK	Emergency Pack Loops	OK	Smoke Signal	2 Pcs
Arch Deflation Valve	OK	Aerial Sockets/Tie-Tapes	OK	Expired Date	02/2028 OK
Entrance Sleeves	OK	Floor Reeds	OK	Parachute Signal	4 Pcs
Outer Floor, Fabric	OK	Rescue Line and Quoit	OK	Expired Date	02/2028 OK
Retaining Straps	OK	Knife Sheath	OK	Red Hand Flare	6 Pcs
Stabilizing Pockets	OK	Sea Anchor	OK	Expired Date	02/2028 OK
Cylinder Pockets	OK	<b>ACCESSORY BAG</b>	OK	First Aid Kit	1 Pcs
Painter Lashing/Storage	OK	Bellow Of Pump	OK	Expired Date	03/2027 OK
(DKF) Loud Test Davit	NA	Light Stick	NA	Anti Seasickness	150 Pcs
Launch And Raft		Repair Kit	OK	Expired Date	11/2030 RN

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "

\*\* Working Code : ( RP = Repair ), ( RN = Renewed ), ( OK = Good ), ( EXP = Expired ), ( SP = Supply ), ( CH = Charge ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

Certificate No.: 034/MJAP/III/26

## RAFT AND CYLINDER TEST

PREASURE TEST	Start			Finish			Preasure	Safety Valves	
	Time	Temp (°C)	Preasure (mmHg)	Time	Temp (°C)	Preasure (mmHg)	Droe (mmHg)	Blow Off (mmhg)	Reseat (mmhg)
Upper Bouyance	10.00	30	131	11.00	30	130	2	161	131
Lower Bouyance	10.00	30	131	11.00	30	130	2	167	131
Floor	-	-	-	-	-	-	-	-	-
Canopy	-	-	-	-	-	-	-	-	-
GAS CYLINDER TEST	Cylinder Number		Manufacture Date		Charge Date	Weight of Cylinder Kg	Weight of CO <sup>2</sup> Kg	Weight of N <sup>2</sup> Kg	Total Weight Kg
	Cylinder No.1		-		-	-	2,600	0,180	16,4
	Cylinder No.2		-		-	-	2,600	0,180	16,4
DAVID LAUNCHABLE RAFT	Remarks	RES:A.761(18)		Remarks	DATE				
Load Test Date:	-	WP-TEST		YES	13/03/2026				
Suspension Straps/Patches	-	FS-TEST		-	-				
Shackle	-	NAP-TEST		-	-				
Steering Line With Patches	-	GI-TEST		-	-				
Bowsing Line With Patches	-	RAFT		Serial No.	AR 2510051		Man of date : 10 - 2011		
Container Line Incl. Pocket	-			Type	FF - QF - A 25		Capacity : 25 Persons		
Pocket for Steering/Bowsing Lines	-			Merk	GUANG ZHOU FENGFAN				

"RAFT IN GOOD CONDOTION"

### Frequency of test

SERVICING INTERVALS	TEST METHODS
End of first year	Wp Test
End of second year	Wp Test
End of third year	Wp Test
End of fourth year	Wp Test
End of fifth year	GI Test
End of sixth year	Wp Test
End of seventh year	Wp Test
End of eighth year	Wp Test
End of ninth year	Wp Test
End of tenth year	GI Test + FS
Eleventh to fourteenth year	GI Test + FS
fifteenth year	NAP test + FS
Sixteenth to nineteenth year	GI test + NAP + FS
Twentieth year	NAP test + FS
Twenty-first to twenty-fourth year	GI test + NAP + FS
Twenty fifth year onwards	GI test + NAP + FS

Working Code :

- NA = Necessary additional pressure test
- WP = Working pressure (compressed air)
- GI = Gas Inflation (fitted gas)
- FS = Floor Seam

Mengetahui,

AGUS FERİYANSYAH  
KAPITAN KANTOR KSOP UTAMA TANJUNG PRIOK  
RABID PERKAPALAN DAN KEPELAUTAN

HEMI CANDRA, ST.M.MTr  
Pembina (Iw/a)  
NIP. 197901162007121001

Surveyor	: AGUS FERİYANSYAH
Next Inspection Date	: 12 MARET 2027

" SERVICE CHARGE LIFERAFT INSPECTED, TESTED AND RAFT IN GOOD CONDITION "



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@gmail.com

## Re-Inspection Certificate Fire Extinguishers

Cert.No : 015/MJAP/PMK/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA • Date : 13 Maret 2026  
• Name Of Ship : CB. PAN MARINE 2

No.	Type	Volume	Quantity	Working Code
1.	DRY POWDER	2,0 Kg	1 Cyls	1, 2, 3
2.	DRY POWDER	3,5 Kg	1 Cyls	1, 2, 3
3.	DRY POWDER	6,0 Kg	5 Cyls	1, 2, 3
4.	CO2 PORTABLE	6.8 Kg	1 Cyls	1, 2, 3
5.	FOAM AFFF	45,0 Ltr	1 Cyls	1, 2, 3
6.	CO2 PORTABLE	7,0 Kg	1 Cyls	6

THIS IS TO CERTIFY that

1. The above mentioned fire extinguisher has been inspected, repaired, and retested in compliance with following scope of work :

- |                           |                       |
|---------------------------|-----------------------|
| 1) Service / Inspected    | 4) Hidrostatic Tested |
| 2) Check Weight / Content | 5) Condemned          |
| 3) Recharged              | 6) New Supply         |

2. On completion, the fire extinguishers is are Re-assemble back to Operation Condition ( Sealed with Pins and Control Labels ).

3. The condition of the above fire extinguishers has been found to satisfaction and in good condition

- Date Of next inspection : 12 Maret 2027



For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector  
At PT. MEGAJAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## FIRE EXTINGUISHERS

### SERVICE REPORT

In Accordance to IMO Resolution A. 951 (23)

Certificate No.: 015/MJAP/PMK/III/26

GENERAL PARTICULARS	
Name Of Ship : CB. PAN MARINE 2	Nationality/Port of Registry : INDONESIA
Owner : PT. PAN MARITIME WIRA PAWITRA	Call Sign : YD4299
IMO-No : 8985452	MMSI No : 525016104
Class : -	Date of Service : 13 Maret 2026
Kind Of Service	
<input checked="" type="checkbox"/> Annual	<input checked="" type="checkbox"/> 5 Yearly
	<input checked="" type="checkbox"/> Repair
REMARKS :	
<i>" Inspection, Repaint, Repair &amp; Refilling "</i>	

FIRE EXTINGUISHERS TYPE
-------------------------

<input type="checkbox"/> Water	<input checked="" type="checkbox"/> CO2	<input type="checkbox"/> Foam AB	<input checked="" type="checkbox"/> Dry Powder	<input checked="" type="checkbox"/> AFFF	<input type="checkbox"/> EEBD / ELSA
--------------------------------	---	----------------------------------	--	--	--------------------------------------

DESCRIPTION OF			
NO.	CHECKLIST ITEM	CHECK	REMARKS
<b>Annual Inspection</b>			
1	Checked for proper location, charging pressure, and Condition; according to the ship's fire plan	Y	GOOD CONDITION
2	Checking safety clip and indicating device	Y	GOOD CONDITION
3	Checking the pressure indicating device	Y	GOOD CONDITION
4	Visual Inspection for corrosion, dent, and damage	Y	GOOD CONDITION
5	Checking the weight	Y	GOOD CONDITION
6	Checking for the hose and nozzles	Y	GOOD CONDITION
7	Checking of operation instruction	Y	GOOD CONDITION
<b>Inspection at recharge</b>			
1	Checking the water and foam charge	Y	GOOD CONDITION
2	Checking for powder charge	Y	GOOD CONDITION
3	Checking for gas cartridge	Y	GOOD CONDITION
<b>Inspection after discharge (5 and 10 year intervals)</b>			
1	Checking air passages and operating mechanism	Y	GOOD CONDITION
2	Operating mechanism	Y	GOOD CONDITION
3	Gas cartridge	Y	GOOD CONDITION
4	O ring washers and hose diaphragms	Y	GOOD CONDITION
5	Checking powder body	Y	GOOD CONDITION
<b>Inspection after recharge</b>			
1	Water and foam	Y	GOOD CONDITION
2	Reassemble	Y	GOOD CONDITION
3	Maintenance label	Y	GOOD CONDITION
4	Mounting of extinguishers	Y	GOOD CONDITION
5	Report	Y	GOOD CONDITION

\*\* Working Code : ( Y = Yes ), ( N = No ) & ( NA = Not Applicable ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@ymail.com

## Re-Inspection Certificate

### CO2 SYSTEM

Cert.No : 004/MJAP/CO2/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA • Date : 13 Maret 2026  
• Name Of Ship : CB. PAN MARINE 2

No.	Cylinder Serial No.	Last Hydro Test Date	Tare Weight ( Kg )	Gross Weight ( Kg )	Volume ( Kg )	Type Of Cylinder	Working Code
1.	K 41107	-	80.4	125.4	45	CO2	1.2
2.	K 41105	-	82.9	127.9	45	CO2	1.2
3.	K 41081	-	81.5	126.5	45	CO2	1.2

THIS IS TO CERTIFY that

1. The above mentioned CO2 System has been inspected, refilled, and retested in compliance with following scope of work :

- |                           |                       |
|---------------------------|-----------------------|
| 1) Service / Inspected    | 4) Hidrostatic Tested |
| 2) Check Weight / Content | 5) Condemned          |
| 3) Refilling              | 6) New Supply         |

2. On completion, the CO2 System is are Re-assemble back to Operation Condition and satisfaction in good condition.

- Date Of next inspection : 12 Maret 2027

# ORIGINAL

For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector  
At PT. MEGAJAYA ABADI PERKASA





# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No. 11 Semper Timur - Jakarta Utara Telp. (021) 440 8538

Fax. (021) 440 8538 E-mail : megajayaabadi@ymail.com

## CO2 SERVICE REPORT

In Accordance to IMO Resolution A. 951 (23)

Certificate No.: 004/MJAP/CO2/III/26

GENERAL PARTICULARS					
Name Of Ship : CB. PAN MARINE 2		Nationality/Port of Registry : INDONESIA			
Owner : PT. PAN MARITIME WIRA PAWITRA		Call Sign : YD4299			
IMO-No : 8985452		MMSI No : 525016104			
Class : -		Date of Service : 13 Maret 2026			
DESCRIPTION OF					
Technical Description					
NO.	TEST	VALUE	VOLUME		
1	Manufacture				
2	Number of Cyls	3	Cyls		
3	Cylinder Capacity	45,0	Kg		
4	Number of Pilot Cyls	1	Cyls		
5	Pilot Cylinder Capacity	1,1	Kg		
6	Number of dist Lines	-	Line		
7	Covering	ENGINE ROOM			
Description of Inspection					
NO.	DESCRIPTION	CARRIED OUT	NOT CARRIED OUT	NOT APPL	COMM.
1	Release system and distance valve secured	X			
2	Contents in cylinders checked by manual weighting	X			
3	<input checked="" type="checkbox"/> Cylinder refilled only <input checked="" type="checkbox"/> Refilled and hydrotest	X			
4	<input checked="" type="checkbox"/> All Cylinder Valve Visually Inspected <input checked="" type="checkbox"/> Leak test		X		
5	All Cylinders frames and connections checked for tightness	X			
6	<input checked="" type="checkbox"/> Manifold distribution valve inspected <input checked="" type="checkbox"/> Tested	X			
7	<input checked="" type="checkbox"/> Main valve distribution valves inspected <input checked="" type="checkbox"/> Tested	X			
8	<input checked="" type="checkbox"/> Total flooding release system inspected <input checked="" type="checkbox"/> Tested	X			
9	<input checked="" type="checkbox"/> Total flooding release system tested <input checked="" type="checkbox"/> Tested	X			
10	Release stations inspected	X			
11	Alarm tested	X			
12	Fan stop tested	X			
13	Distribution lines and nozzles inspected	X			
14	Distribution lines and nozzles tested		X		
15	Distribution lines and nozzles blown through		X		
16	Smoke detention system tested according to service chart lines			X	
17	dansih REQ 5 years press test servo system ( 1,3 WP ) distr lines holds ( 25 Bar ) manifold ( 60 Bar )		X		
18	All doors hinges locks inspected	X			
19	All instructions plates on installation inspected	X			
20	System reconnected, sealed and left in operational order inspection date labels	X			

\*\* Working Code : ( X = Yes ) , ( N = No ) & ( NA = Not Applicable ) \*\*



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## Re-Inspection Certificate Medical Oxygen Device

Cert.No : 002/MJAP/MO/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA • Date : 13 Maret 2026  
• Name Of Ship : CB. PAN MARINE 2

No.	Cylinder Serial No.	Test Pressure	Working Pressure	Cylinder Capacity	Type Of Cylinder	Working Code
1.	5581	300 Bar	200 Bar	4,0 Ltr	AIR	1,2,3

THIS IS TO CERTIFY that

1. The above mentioned Medical Oxygen Device ( MO ) has been inspected, refilled, and retested in compliance with following scope of work :

- |                             |                       |
|-----------------------------|-----------------------|
| 1) Service / Inspected      | 4) Hidrostatic Tested |
| 2) Check Pressure / Content | 5) Condemned          |
| 3) Refilling                | 6) New Supply         |

2. On completion, the Medical Oxygen Device ( MO ) is are Re-assemble back to Operation Condition ( Sealed with Pins and Control Labels ) and satisfaction in good condition.

- Date Of next inspection : 12 Maret 2027

For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector  
At PT. MEGAJAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara

Telp. (021) 440 8538 Fax. (021) 440 8538

E-mail : megajayaabadi@ymail.com

## Re-Inspection Certificate Breathing Apparatus

Cert.No : 004/MJAP/BA/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA • Date : 13 Maret 2026  
• Name Of Ship : CB. PAN MARINE 2

No.	Cylinder Serial No.	Test Pressure	Working Pressure	Cylinder Capacity	Type Of Cylinder	Working Code
1.	002187	300 Bar	200 Bar	4,0 Ltr	AIR	1,2
2.	002746	300 Bar	200 Bar	4,0 Ltr	AIR	1,2
3.	001220	300 Bar	200 Bar	4,0 Ltr	AIR	1,2

THIS IS TO CERTIFY that

1. The above mentioned Breathing Apparatus has been inspected, refilled, and retested in compliance with following scope of work :

- 1) Service / Inspected
- 2) Check Pressure / Content
- 3) Refilling
- 4) Hidrostatic Tested
- 5) Condemned
- 6) New Supply

2. On completion, the Breathing Apparatus is are Re-assemble back to Operation Condition ( Sealed with Pins and Control Labels ) and satisfaction in good condition.

- Date Of next inspection : 12 Maret 2027

For and on behalf of



FERIYANSYAH

Approved Signatory for chief Inspector  
At PT. MEGAJAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Re-Inspection Certificate* *Emergency Escape Breathing Device*

Cert.No : 003/MJAP/EEBD/III/26

- Customer : PT. PAN MARITIME WIRA PAWITRA • Date : 13 Maret 2026  
• Name Of Ship : CB. PAN MARINE 2

No.	Cylinder Serial No.	Test Pressure	Working Pressure	Cylinder Capacity	Type Of Cylinder	Working Code
1.	AA 833467	300 Bar	200 Bar	2,0 Ltr	AIR	1,2,3
2.	2206	300 Bar	200 Bar	2,0 Ltr	AIR	1,2,3

THIS IS TO CERTIFY that

1. The above mentioned Emergency Escape Breathing Device ( EEBD ) has been inspected, refilled, and retested in compliance with following scope of work :

- |                             |                       |
|-----------------------------|-----------------------|
| 1) Service / Inspected      | 4) Hidrostatic Tested |
| 2) Check Pressure / Content | 5) Condemned          |
| 3) Refilling                | 6) New Supply         |

2. On completion, the Emergency Escape Breathing Device ( EEBD ) is are Re-assemble back to Operation Condition ( Sealed with Pins and Control Labels ) and satisfaction in good condition.

- Date Of next inspection : 12 Maret 2027

For and on behalf of



**FERIYANSYAH**

**Approved Signatory for chief Inspector**  
**At PT. MEGAJAYA ABADI PERKASA**



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate*

No : 033 / MJAP / HRU / III / 26

**Name of Ship** : CB. PAN MARINE 2  
**NamaKapal**

**Owner / Address** : PT. PAN MARITIME WIRA PAWITRA  
**Pemilik / Alamat**

**Hydrostatic Release Serial Nomor** : 87071 2501 815  
**Serial Number Hydrostatic**

**Type** : H20R  
**Model**

**Manufacturer** : HAMMAR  
**Buatan**

**Remarks** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION  
**Catatan**

**ExpiredDate** : MARET - 2027  
**Batas Penggunaan**

ORIGINAL

For and on behalf of



FERIYANSYAH

Approved signatory for Chief Inspector  
at PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## “ Certificate ”

No : 034 / MJAP / HRU / III / 26

**Name of Ship** : CB. PAN MARINE 2  
**NamaKapal**

**Owner / Address** : PT. PAN MARITIME WIRA PAWITRA  
**Pemilik / Alamat**

**Hydrostatic Release Serial Nomor** : 87069 2501 815  
**Serial Number Hydrostatic**

**Type** : H20R  
**Model**

**Manufacturer** : HAMMAR  
**Buatan**

**Remarks** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION  
**Catatan**

**ExpiredDate** : MARET - 2027  
**Batas Penggunaan**

ORIGINAL

For and on behalf of



FERIYANSYAH

Approved signatory for Chief Inspector  
at PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## “ Certificate ”

No : 035 / MJAP / HRU / III / 26

**Name of Ship** : CB. PAN MARINE 2  
**NamaKapal**

**Owner / Address** : PT. PAN MARITIME WIRA PAWITRA  
**Pemilik / Alamat**

**Hydrostatic Release Serial Nomor** : 87063 2501 815  
**Serial Number Hydrostatic**

**Type** : H20R  
**Model**

**Manufacturer** : HAMMAR  
**Buatan**

**Remarks** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION  
**Catatan**

**ExpiredDate** : MARET - 2027  
**Batas Penggunaan**

ORIGINAL

For and on behalf of



FERIYANSYAH

Approved signatory for Chief Inspector  
at PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## “ Certificate ”

No : 036 / MJAP / HRU / III / 26

**Name of Ship** : CB. PAN MARINE 2  
**NamaKapal**

**Owner / Address** : PT. PAN MARITIME WIRA PAWITRA  
**Pemilik / Alamat**

**Hydrostatic Release Serial Nomor** : 87061 2501 815  
**Serial Number Hydrostatic**

**Type** : H20R  
**Model**

**Manufacturer** : HAMMAR  
**Buatan**

**Remarks** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION  
**Catatan**

**ExpiredDate** : MARET - 2027  
**Batas Penggunaan**

ORIGINAL

For and on behalf of



FERIYANSYAH

Approved signatory for Chief Inspector  
at PT. MEGA JAYA ABADI PERKASA



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## “ Certificate ”

No : 037 / MJAP / HRU / III / 26

**Name of Ship** : CB. PAN MARINE 2  
**NamaKapal**

**Owner / Address** : PT. PAN MARITIME WIRA PAWITRA  
**Pemilik / Alamat**

**Hydrostatic Release Serial Nomor** : 87062 2501 815  
**Serial Number Hydrostatic**

**Type** : H20R  
**Model**

**Manufacturer** : HAMMAR  
**Buatan**

**Remarks** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION  
**Catatan**

**ExpiredDate** : MARET - 2027  
**Batas Penggunaan**

ORIGINAL

For and on behalf of



**FERIYANSYAH**  
**Approved signatory for Chief Inspector**  
**at PT. MEGA JAYA ABADI PERKASA**



# PT. MEGAJAYA ABADI PERKASA

GENERAL SUPPLIER & MARINE SAFETY, SERVICE LIFERAFT,  
RUBBER BOAT, LIFE JACKET & FIRE EXTINGUISHER

Jl. Kebantenan III No.11 Semper Timur - Jakarta Utara  
Telp. (021) 440 8538 Fax. (021) 440 8538  
E-mail : megajayaabadi@ymail.com

## *Certificate*

No : 038 / MJAP / HRU / III / 26

**Name of Ship / NamaKapal** : CB. PAN MARINE 2

**Owner / Address / Pemilik / Alamat** : PT. PAN MARITIME WIRA PAWITRA

**Hydrostatic Release Serial Nomor / Serial Number Hydrostatic** : 87091 2501 815

**Type / Model** : H20R

**Manufacturer / Buatan** : HAMMAR

**Remarks / Catatan** : HYDROSTATIC RELEASE UNIT IN GOOD CONDITION

**ExpiredDate / Batas Penggunaan** : MARET - 2027

ORIGINAL

For and on behalf of



FERIYANSYAH

Approved signatory for Chief Inspector  
at PT. MEGA JAYA ABADI PERKASA